

Exhibit 36

From: Hossein Ruhi
To: Mak Daoud
Date: Wednesday, August 08, 2007 2:32:12 PM
Subject: Re: Fwd: 5700 Block of Soledad Mt. Road - Concerns of Citizens

Thanks Mak. and hi to ever body who is copied this email .We have not found any voids under the pavement . Therefor, I am concluding that this is part of a very slow movement/settlement related to water in the sub-grade and/ or trench that has caused and movement and has stopped for now . However, we will keep an eye on it to assure this is the case .

>>> Mak Daoud 08/07/2007 3:49:19 PM >>>
Hi Hossein;
Attached are the coring results for the subject location.

>>> Hossein Ruhi 7/27/2007 10:37 AM >>>

With this email I am asking that our lab do an exploratory coring to see if there is void under the pavement or not . If there is no void then we should prob thru the hole to see if the soil is loose or not . if it is loose then we need to do a n appropriate repair otherwise just overlay the sunken areas .

>>> Robert Ferrier 07/27/2007 10:19 AM >>>
Chris,
Sounds good.
What's the next step re the subsidence?
RJF

>>> Christopher Toth 7/27/2007 9:07 AM >>>
the sewer mains in this area are reported to be in good shape and not structurally impacted by soil movement. Chris


CC: Christopher Toth; Earl Lokers; Jim Fisher; Rob Hawk; Robert Ferrier



South
Bound Lane

North
Bound Lane

5726 Address

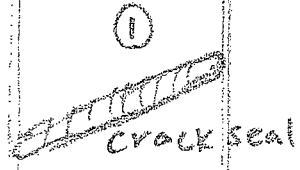

②

④

③

⊗ F.H.



A.C. Patch

Soledad Mountain Rd.

5714 Address

⑤

Exhibit 37

Sewer/Water Infrastructure Management

Actions



Work Order Data Entry

SR#: 3003498	Wo#: 1	Priority: 1	Radio #: 1943	Wtr/Swr: W	WO Stat: CMP	WO Recd Dt:	Orig Prob Cd: 1161
Prob Cd / Primary Ind: 1161 Y		Field Bk Pg/Grid: C12S				Thomas Bros Pg: 1248A2	
Street #	Frac	Dir	Street Name	Sfx	Suite#	Jurisdiction	Data Steward: 1970 MICHAEL BASOM
5712			SOLEDAD MTN	RD		SD	X St:
Inter:							
Loc Desc:		SEEPING THRU CRACK IN STRT					
Job Desc:							
Special Inst:							
Service Area: 2		ES Service Area: W		Plant Service Area: MI		Assign Dt: 08/10/07 04:50	
						WO Gen Dt: 08/10/07 04:02	

USA#:	Exp Dt:	Fac Typ: WSVC	Fac Seq#: 853806	Request: SDG&E	Plw: 619
-------	---------	---------------	------------------	----------------	----------

Work Cd	Action Cd	Service Request Comments
ESINV	INV	ST: 08/10/07 05:40
ESINV	REF	End: 08/10/07 06:20
		JO #: 53546
		Emp: 1
		His: 0.70

WO Comments: Page 1 of 1	INV LEAK ON 1" SVC... MARKED OUT USA - WORK ORDER 3 REFERRED TO RADIO # 1810
Creation D/Time: 8/10/07 7:09	
Upd D/Time: 8/10/07 7:09	LXR

Completed by Radio #:	Cancel:	Total Crew Hours: 0.57
-----------------------	---------	------------------------

Referral Priority:	Ref to Radio:	Work Code:	Fac Type:	Fac Seq #:
Job Desc:				

Last Update Dt: 8/10/07 13:29	Last Update ID: LXR	Last Batch Update Dt: 8/13/07 3:59	Last Batch Update ID: U97SRCLN
WO Completed Dt: 8/10/07 7:09	Completed By: LXR		

Please Wait.... Swim is currently sending this screen to your printer.

Start Sewer/Water I...

Sewer/Water Infrastructure Management



Work Order Data Entry

SR#: 3003498	Wo#: 2	Priority: 1	Radio #: 1944	Wtr/Swr: W	WO Stat: CMP	WO Recd Dt:	Orig Prob Cd: 1161
Prob Cd / Primary Ind: 1161 Y							Field Bk Pg/Grid: C12S
Street#	Frac	Dir	Street Name	Sfx	Suite#	Jurta	Data Steward: 1970 MICHAEL BASOM
5712			SOLEDAD MTN	RD		SD	X St:
Inter:							Thomas Bros Pg: 1248A2
Loc Desc: SEEPING THRU CRACK IN STRT							Service Area: 2
Job Desc:							ES Service Area: W
Special Inst:							Plant Service Area: MI
							Assign Dt: 08/10/07 05:26
							WO Gen Dt: 08/10/07 04:50

USA#:	Exp Dt:	Fac Typ: WSVC	Fac Seq#: 853606	Request: SDG&E	Ph#: 619
-------	---------	---------------	------------------	----------------	----------

Work Cd	Action Cd	Service Request Comments	
ESINV	REF11		
ST:	08/10/07 09:45	End:	08/10/07 10:00
JO#:	53546	Emp:	1
Hrs:	0:30		

WO Comments: Page 1 of 1	REFER VIA 38 TO AREA SUPERVISOR TO 11-11 PR PROBLEM
Creation Dt/Tm: 8/13/07 10:02	
Upd Dt/ID: 8/13/07 10:02 HBL	

Completed by Radio #:	Cancel:	Total Crew Hours: 0:25
-----------------------	---------	------------------------

Referral Priority:	Ref to Radio:	Work Code:	Fac Type:	Fac Seq #:
Job Desc:				

Last Update Dt: 8/13/07 10:02	Last Update ID: HBL	Last Batch Update Dt: 8/14/07 4:02	Last Batch Update ID: U97SRQIN
WO Completed Dt: 8/13/07 10:02	Completed By: HBL		

Please Wait... Swim is currently sending this screen to your printer

Sewer/Water Infrastructure Management

Actions



Work Order Data Entry

SR #: 3003498	Wd#: 3	Priority: 1	Radio #: 1810	Wtu/Swr: W	WO Stat: CAN	WO Recd Dt:	Orig Prob Cd: 1161
Prob Cd / Primary Ind: 1161 Y							Field Bk Pg/Grid: C12S
Street #	Frac	Dir	Street Name	Sfx	Suite#	Juris	Data Steward:
5712			SOLEDAD MTN	RD		SD	X St:
Inter:							Thomas Bros Pg: 124BA2
Loc Desc: SEEPING THRU CRACK IN STRT							Service Area: 2
Job Desc: RPR OR RPL 1" SVC							ES Service Area: W
Special Inst:							Plant Service Area: MI
							Assign Dt:
							WO Gen Dt: 08/10/07 07:09

USA#:	Exp Dt:	Fac Typ: WSVC	Fac Seq#: 853806	Request: SDG&E	Ph#: 619
-------	---------	---------------	------------------	----------------	----------

Work Cd	Action Cd	Service Request Comments			
RPR					
ST: 00/00/00 00:00	End: 00/00/00 00:00	JO #:	Emp:	Inv:	

WO Comments: Page 1 of 1

Creation Dt/Tm:

Upd Dt/Tm:

Completed by Radio #:	Re-Open:	Total Crew Hours:
Referral Priority:	Ref to Radio:	Work Code:
Fac Type:	Fac Seq #:	
Job Desc:		

Last Update Dt: 8/13/07 7:59	Last Update ID: FMP	Last Batch Update Dt:	Last Batch Update ID:
WO Completed Dt:	Completed By:		

Please Wait.... Swim is currently sending this screen to your printer.

Start Sewer/Water I...

Exhibit 38

Sewer/Water Infrastructure Management

Actions



Work Order Data Entry

SR #:	3003498	Wo#:	4	Priority:	1	Radio #:	1834	Wtr/Swr:	W	WO Stat:	CMP	WO Recd Dt:		Orig Prob Cd:	1161
Prob Cd / Primary Ind:														1161	Y
Street #	Frac	Dir	Street Name			Sfx	Suite#	Juris	Data Steward:			1630 JEFF REMSBURG			
5712			SOLEDAD MTN			RD		SD	X St:						
Inter:															
Loc Desc:														SEEPING THRU CRACK IN STRT	
Job Desc:														RECALL TO SUPERVISOR PER CON @ FIELD ENG ST STARTING TO SHIFT PLS ASAP	
Special Inst:															
Field Bk Pg/Grid:														C12S	
Thomas Bros Pg:														1248A2	
Service Area:														2	
ES Service Area:														W	
Plant Service Area:														MI	
Assign Dt:														08/10/07 08:37	
WO Gen Dt:														08/10/07 08:02	

USA#:		Exp Dt:		Fac Typ:	WTRM	Fac Seq#:	389251	Request:	SDG&E	Ph#:	619	
-------	--	---------	--	----------	------	-----------	--------	----------	-------	------	-----	--

Work Cd	Action Cd	Service Request Comments	
RPR	RPR	ST:	08/10/07 08:00
		End:	08/10/07 15:00
		JO #:	53519
		Emp:	5
		Hrs:	7.00

WO Comments:	Page 1 of 1	INSTALLED 12" AC MAIN REPAIR BAND AND RECONNECTED 3/4" SVC TO REPAIR CRACK ON MAIN AT THE CORP
Creation Dt/Tm:	8/13/07 7:51	WORK ORDER 6 REFERRED TO RADIO # 1930
Upd Dt/ID:	8/13/07 7:51 FME	

Completed by Radio #:		Cancel:		Total Crew Hours:	35.00
-----------------------	--	---------	--	-------------------	-------

Referral	Priority:		Ref to Radio:		Work Code:		Fac Type:		Fac Seq #:	
Job Desc:										

Last Update Dt:	8/13/07 7:51	Last Update ID:	FME	Last Batch Update Dt:	8/14/07 4:02	Last Batch Update ID:	U97SRCLEN
WO Completed Dt:	8/13/07 7:51	Completed By:	FME				

Please Wait... Swim is currently sending this screen to your printer.

Exhibit 39

From: Rob Hawk
To: Barrett, Jim; Fisher, Jim; Ruhi, Hossein; Ruiz, Alex
Date: Fri, Aug 10, 2007 1:43 PM
Subject: Re: Fwd: Water leakon Soledad mt.rd

To All:

I visited the site this morning based on several calls from residents. The water service line pulled the corp from the AC main, causing the leak. In addition, another gas line nearby failed last night. Based on my observations, I do not believe that a threatening life or safety condition exists at this time. However, the temporal pattern of events and some of the distress features to improvements indicate that we need to be concerned about adding water to the subsurface in this area. I recommend any reported water leaks on Soledad Mountain Road or Desert View Drive receive high priority for repair.

I understand that Hossein will arrange a meeting next week with you that should include the Water Department advisory attorney. If you have any questions, please call. My cell is 619-980-7161.

Rob Hawk

Robert N. Hawk, PE
 Senior Engineering Geologist/Deputy City Engineer
 City of San Diego, Engineering and Capital Projects
 Field Engineering Division, MS 18
 9485 Aero Drive San Diego, CA 92123
 (858) 573-5011
 (858) 627-3297 (Fax)
 rhawk@sandiego.gov

Working Together to Engineer a Better Tomorrow

>>> Hossein Ruhi 8/10/07 8:38 AM >>>
 FYI.

>>> Hossein Ruhi 08/10/2007 8:35:15 AM >>>
 FYI, There is a water leak at 5700 block of Soledad Mt. rd . The citizen called and they are very worried about it since the live on the hillside . This has been reported to the emergency services already .

CC: Boekamp, Patti